

SERVICE BULLETIN



PAGING MODULATOR CARDS CI-PM-3-00

BULLETIN NUMBER:	SB-0011
REVISION:	A
DATE:	NOV 2004

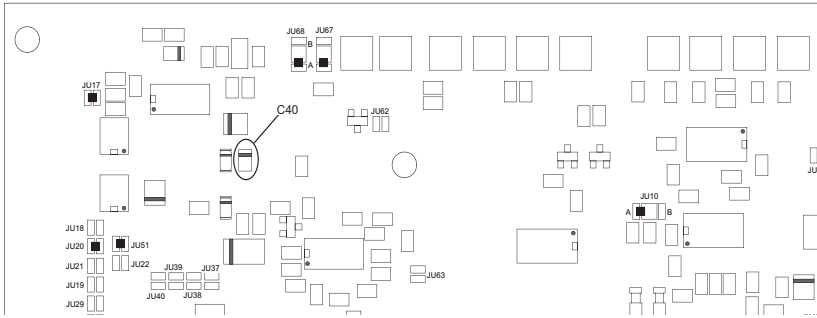
PRODUCT DESCRIPTION:	PAGING MODULATOR CARD
-----------------------------	-----------------------

DE REFERENCE / ECO:	ECO # 832
----------------------------	-----------

PRODUCTS EFFECTED:	Model Number	Board Versions
	CI-PM-3-00	50029-07

SYMPTOMS:		Component failure could result in module failure, blown subrack fuse, or system failure.	
------------------	---	--	---

CAUSE:	capacitor voltage under rated
---------------	-------------------------------

SOLUTION:	Remove C40 (a 1.0 μ f 16 V Tant) and/or replace with a 1.0 μ f 35 V Tantalum Capacitor
	

PARTS REQUIRED:	<p>If replacing C40:</p> <p>DE part number: 1055-5B105M35 CAP., SM, 1.0uF TANT., 20%,35V KEMET T491B105M035AS</p>
------------------------	---

RETURN REQUESTS:	To have affected product returned to Daniels Electronics for servicing (or replacement, etc...), please contact the service department to obtain and RMA number and return shipping instructions at 1-800-664-4066
-------------------------	--

REVISION HISTORY:	<u>Rev Date</u>	<u>Description</u>
	A 23/11/04	First Release