

SERVICE BULLETIN

BULLETIN NUMBER: SB-0057
REVISION: 02
DATE: APR-2015

PRODUCT DESCRIPTION: Codan TRRSM Configuration Utility – Programming Procedure

DE REFERENCE / ECO: AT-24421

PRODUCTS AFFECTED: Codan Single Site Trunking Systems

CAUSE / SYMPTOMS: A conflict exists between the TRRSM configuration utility and the universal interface card (UIC). The configuration utility **should not** be connected to the system while the UIC is powered on.

NOTE:

To complete this procedure, the trunking system must be taken offline. Appropriate arrangements should be made with the end user.

PROCEDURE:

Follow the instructions below to view or change the trunking configuration.

1. Power down all Codan subracks by switching the breakers or turning off the DC power supplies.
2. Connect a PC to the trunking network.
3. Open the TRRSM configuration utility.
*The default address is **192.168.6.18** and **port 7000**.*
4. Make any necessary changes to the trunking configuration.
5. Press the **Program** button.
Allow programming to complete.
6. Press the **Restart System** button to reset the trunking controller.
Allow the reset to complete.
7. Close the TRRSM configuration utility.
8. Power up all Codan subracks by switching the breakers or turning on the DC power supplies.
The control channel should come online within one minute.

RETURN REQUESTS: To obtain an RMA number and shipping instructions, please contact the Codan service department at 1-800-664-4066 or lmrservice@codancomms.com.

REVISION HISTORY:

Rev	Date	Description
1-0-0	April 2015	First Release
02	Dec 2018	Update to Codan Communications



SB-0057-02
Dec 17, 2018
QA-163 Rev 09
PUBLIC

PRINTED COPY NOT CONTROLLED